


## GENERAL NOTES:

- A. REPAIR (E) DAMAGED WOOD SUBSTRATES AS REQUIRED.
- B. REHABILITATE (E) SLATE SHINGLE ROOF SYSTEM BY REMOVING SHINGLES, UNDERLAYMENT AND FLASHING; PROVIDING NEW FLASHING AND UNDERLAYMENT; AND REINSTALLING SLATE SHINGLES.
- C. REPLACE ANY CRACKED, DETERIORATED OR BROKEN SLATE SHINGLES WITH NEW SLATE SHINGLES MATCHING (E) IN SIZE, SHAPE, AND COLOR, AND TYPE OF SLATE.
- D. PROVIDE FLASHING AT (N) PIPE PENETRATIONS, CW/ PLUMBING. RE: A7.1-3 FOR PIPE PENETRATIONS @ METAL ROOF.
- E. REMOVE ALL EXISTING DOWN SPOUT BRACKETS, COLLECTOR BOXES, AND SPLASH BLOCKS.
- F. PROTECT ALL EXISTING WORK INDICATED TO REMAIN FROM DAMAGE DURING CONSTRUCTION, ANY MATERIALS, SYSTEMS, COMPONENTS, FINISHES, AND THE LIKE, DAMAGED DURING CONSTRUCTION SHALL BE REPAIRED OR REPLACED TO OWNERS ACCEPTANCE AT CONTRACTOR'S EXPENSE.
- G. COORDINATE WITH 3RD FLOOR PLAN, EXTERIOR ELEVATIONS, AND RESTORATION DRAWINGS FOR ADDITIONAL WORK.
- H. REFER TO DRAWINGS A3.2 THRU A3.9 FOR RESTORATION DRAWINGS.

## # SHEET NOTES:

1. REPLACE (E) BUILT-UP ROOF WITH (N) STANDING SEAM METAL ROOF WITH INTEGRA GUTTER SYSTEM.
2. REPLACE (E) WOOD SHINGLE ROOF WITH (N) STANDING SEAM METAL ROOF.
3. REPLACE (E) SHEET METAL GUTTER AND DOWN SPOUTS WITH (N) PRE-FINISHED METAL UNITS.
4. REHABILITATED (E) SLATE ROOF AND DORMERS.
5. REPAIR AND CLEAN (E) BRICK CHIMNEY.
6. REPAIR AND POWDER COAT (E) VENTILATOR. RE: RESTORATION DRAWINGS.
7. SINGLE-PLY MEMBRANE ROOFING SYSTEM. RE: RESTORATION DRAWINGS.
8. PRE-FINISHED SHEET METAL COPING/CORNICE.
9. REPLACE (E) COPPER GUTTER AND DOWN SPOUT SYSTEM WITH NEW COPPER UNITS TO MATCH EXISTING. REPAIR WOOD CORNICE AS REQUIRED. RE: RESTORATION PLANS.
10. THROUGH WALL SCUPPER AND DOWN SPOUT, RE:A7.1-4.
11. CRICKET.
12. ELEVATOR SHAFT, TOP SHALL BE A SINGLE PLY MEMBRANE ROOF, EXTEND DOWN WALLS OF SHAFT TO LOWER ROOF.
13. RIDGE LINE.
14. LOCATION OF DOWN SPOUT, CW/ EXTERIOR ELEVATIONS.
15. CANOPY BELOW. RE: EXTERIOR ELEVATIONS.
16. NEW SLATE ROOF CONNECTION TO STAIR/ELEVATOR TOWER EXTEND DORMER TO NEW ADDITION. MATCH PATTERNING, SLOPE, HEIGHT, AND WIDTH OF EXISTING SLATE ROOF.

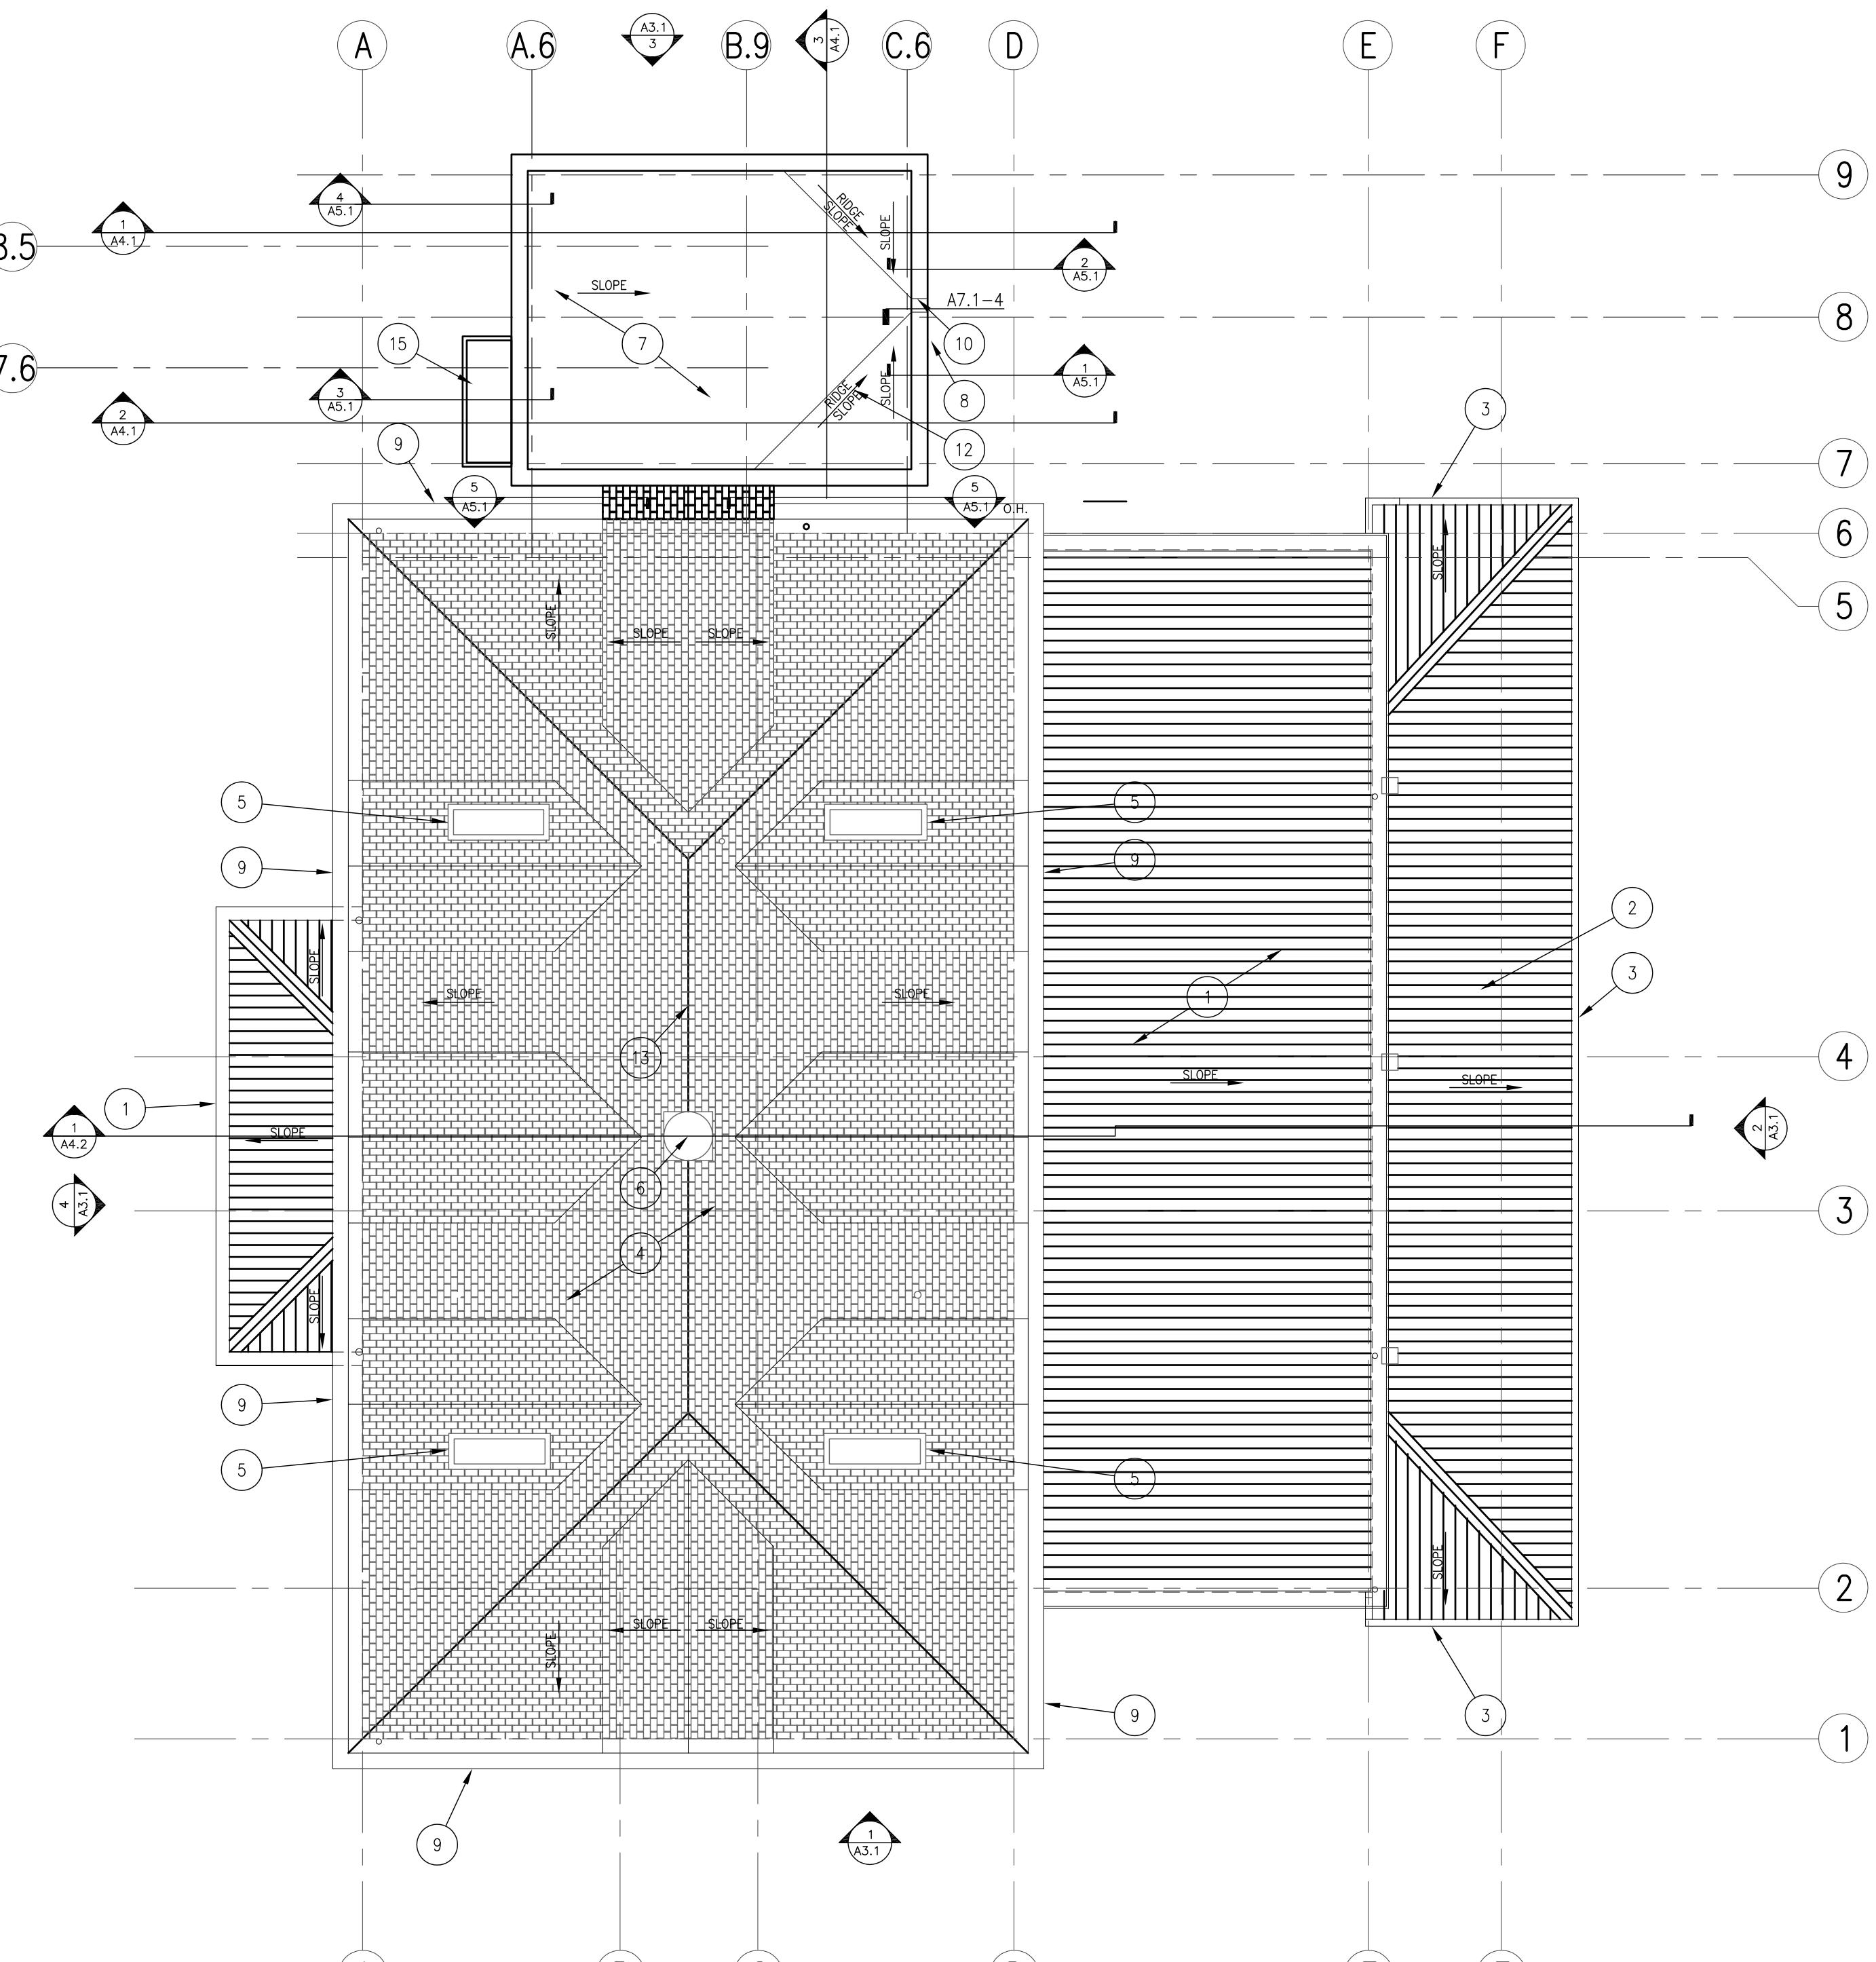

95% SUBMISSION

**CSHQ**A

C.W. MOORE PLAZA  
250 S. 5TH ST. - BOISE, ID 83702  
(208) 343-4635 • FAX (208) 343-1898  
<http://www.cshqa.com>

JOHN D. MAULIN, ARCHITECT  
C.W. MOORE PLAZA  
250 S. 5TH ST.  
BOISE, IDAHO  
PHONE: 208-343-4635 FAX: 208-343-1898  
PHONE: 208-343-4635 FAX: 208-343-1898  
http://www.cshqa.com


STAMP

PRELIMINARY  
NOT FOR  
CONSTRUCTION

DRAWING TITLE  
ROOF PLANS

PROJECT TITLE  
VAMC  
RENOVATE  
BUILDING 33

DATE  
03/04/11  
PROJECT NO.  
531-10-114

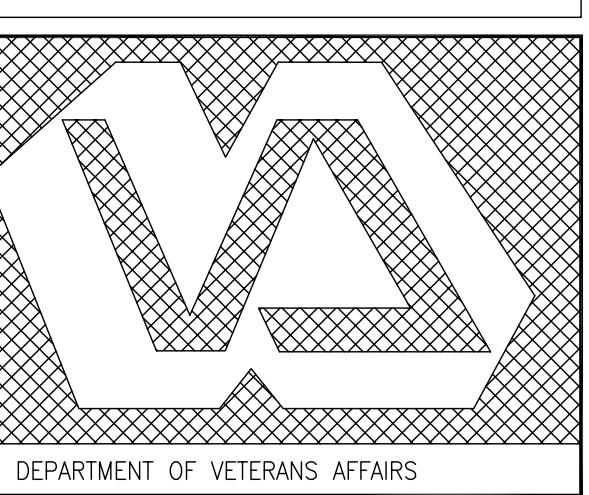

APPROVED: DIVISION CHIEF

BUILDING NUMBER  
33

CHECKED  
JMO  
DRAWN  
BKS

DRAWING NO.  
A2.1

APPROVED: SERVICE DIRECTOR

LOCATION  
BOISE, IDAHO

DWG. 21 OF 102